


HOW TO UPDATE MY WELDING EXPERT SOFTWARE?

Before installing the new release of Welding Expert, please make a copy of the actual installation folder.

The default path for the installation is the following : C:\ClaraVision\Welding_Expert

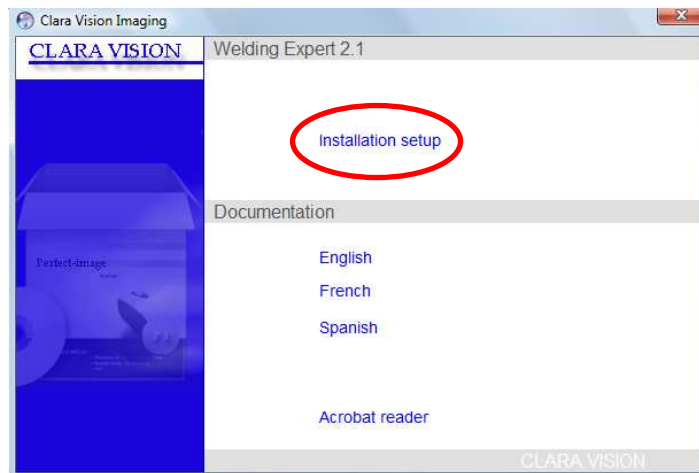

Launch the installation setup and install the new release in the same folder as the old one (The default path for the installation is the following : C:\ClaraVision\Welding_Expert).

When done, launch Welding Expert software.

Enter administration mode.




Default password to enter administration mode is : admin

In administration mode, go to General description



And select the configuration you want to work with :

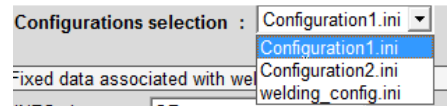

You're ready to work with the release.